

ship Dec 9 or sooner

Work Order ID 76647

76647

Page 1

Item ID: D3267-041

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Basket lid Assembly (Outside)

Start Date: 18/11/2011 Start Qty: 1.00

1

Cust Item ID:

Required Date: 09/12/2011 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: M.L.J. Date: 11/11/18 Tooling:

Run Start *NR1*

QC: Date: SPC (Y/N):

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D3267	Rev C								

100 Weld per dwg A/R S.S. rod Batch: M115778 0.00

100

Large Fab

Large Fab

Memo

0.00

Large Fab

1-Cut Rib from 3/4" x 3/4" x 0.063" wall 304/316 SS tubing as per Dwg D3267

2-Cut (4) D2236-1 From D3166-3

3-Drill holes in tubing D3267-041 as per Dwg D3267

4-Deburr & Remove All Markings From Material

5-Weld D3267-041 Assembly using Welding Table and corner Jig as per Dwg D3267. Deburr as required

Note: Expanded metal "diamonds" must run lengthwise. Eg 2.0" along length of lid.

6-Drill Ø0.257" hole in D3267-041 as per Dwg D3267 Identify as D3267-041

SD 11/11/07 (K)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

November-18-11 10:38:07 AM

Page 2

Setup Start *NS1*

Stop *NS2*

Customer:

Run Start *NR1*

Stop *NR2*

**Insp.
Stamp**

Quality Control

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 76647

76647

Page 3

November-18-11 10:38:07 AM

Item ID: D3267-041 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Basket lid Assembly (Outside)
 Start Date: 18/11/2011 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 09/12/2011 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

130	White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum	0.00							
-----	--	------	--	--	--	--	--	--	--

130

Powdercoat

Powder Coating

Memo

0.00

POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

1ST COAT

START TIME:

OVEN TEMPERATURE:

FINISH TIME:

***** 2nd coat, if necessary*****

2ND COAT:

START TIME:

OVEN TEMPERATURE:

FINISH TIME:

140

0.00

140

HandFinish

Hand Finishing

HandFinishing

Memo

0.00

Wing walk as per Dwg D3267 and QSI 005 4.4

Spray Paint Black:

Wing Walk:

Handwritten: NO M-11/12/08

Handwritten: Pto ->

Handwritten: 1 BK 11-12-9

Handwritten: M119480

Handwritten: 9:15 OF 400 9:45

Handwritten: 11/12/08

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	
11/12/08	#130	turn b to Automatic Lid as per DSZ 9473	PL	11/12/08				
11/12/08	#30	QC6 Reinsert	S	11/12/08			S 11/12/08	
11/12/08		Re powder coat as per Qs2 004 Start 2:30 Fin 11:00 temp 400 OF	M	11/12/08			S 11/12/08	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 76647

76647

Page 4

November-18-11 10:38:07 AM

Item ID: D3267-041 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Basket lid Assembly (Outside)
 Start Date: 18/11/2011 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 09/12/2011 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
150	QC3- Inspect Part Finish	0.00							
150									
QC	Memo	0.00							1 11/12/09
Quality Control									
155	Identify as per dwg & Stock Location: B-A	0.00							
155									
Packaging	Memo w/o 76641	0.00							
Packaging									
160	QC21- Final Inspection - Work Order Release	0.00							
160									
QC	Memo	0.00							CK 11/12/09
Quality Control									

11.12.09

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

November-18-11 10:38:12 AM

Page 1

Work Order ID: 76647

76647

Parent Item: D3267-041

D3267-041

Parent Item Name: Basket lid Assembly (Outside)

Start Date: 18/11/2011

Required Date: 09/12/2011

Start Qty: 1.00

Required Qty: 1.00

Comments:

IPP Rev:C Removed -043 05-11-04 JLM
 IPP Rev:D 08-09-10 revC as per dwg (ecn 08-524) DD verified
 by:EC IPP Rev:E add I.D. DD 10.03.11 verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D2327-3 *D2327-3* Spacer Bushing		Manufactured	No			100	Each	21.0000	2	2			
									**	B75564 → 2x 11/11/07			
				<u>Location</u>			<u>Loc Qty</u>		<u>Loc Code</u>				
				WA			21						
					72963		1						
					74782		20						
D2506 *D2506* Label Plate		Manufactured	No			100	Each	11.0000	1	1			
									**	11/12/07			
				<u>Location</u>			<u>Loc Qty</u>		<u>Loc Code</u>				
				WA			11						
					71087		1						
					74142		10						
D2581 *D2581* Mounting Bracket		Manufactured	No			100	Each	17.0000	2	2			
									**	11/12/07			
				<u>Location</u>			<u>Loc Qty</u>		<u>Loc Code</u>				
				WA			17						
					69739		2						
					70766		2						
					73762		13						

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

November-18-11 10:38:12 AM

Page 2

Work Order ID: 76647

76647

Parent Item: D3267-041

D3267-041

Parent Item Name: Basket lid Assembly (Outside)

Start Date: 18/11/2011

Required Date: 09/12/2011

Start Qty: 1.00

Required Qty: 1.00

D3166-3 Manufactured No

100 Each

6.0727

1

1

D3166-3

Basket Hoop

**

SY 11/12/07

Location

Loc Qty

Loc Code

WA

6

73627

6

WA007

0.07270527

64928

0.02010527

68442

0.0526

(1x)

M304EX0.75-16F

Purchased

No

100 sf

554.2561

7.8

8.210526

M304FX0 75-16F

Expanded Metal Flat SS

**

SY 11/12/07

Location

Loc Qty

Loc Code

WA

554.2561116

117197

102.9036

117896

53.3264

118153

76.8473

118248

33.0983

118597

21.06788

118955

82.17

119180

184.842632

8.21

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

November-18-11 10:38:12 AM

Page 3

Work Order ID: 76647

76647

Parent Item: D3267-041

D3267-041

Parent Item Name: Basket lid Assembly (Outside)

Start Date: 18/11/2011

Required Date: 09/12/2011

Start Qty: 1.00

Required Qty: 1.00

M304TS0.750W.065

Purchased

No

100

f

506.7499

30.6

32.21053

M304TS0 750W 065

304 SQ Tube .75x.75x.065W

**

11/12/07

Location

Loc Qty

Loc Code

MAT018

485.0857585

117636

67.9987

118773

417.087059

WA

6.0667

118181

6.0667

WA007

15.5974906

116267

14.628472

116763

0.9690186

33.21

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ **PAR #:** _____ **Fault Category:** _____ **NCR: Yes No** **DQA:** _____ **Date:** _____
Resolution: _____ **Disposition:** _____ **QA: N/C Closed:** _____ **Date:** _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

QTY -041	QTY -043	PART NUMBER	DESCRIPTION
X		D3267-041	BASKET LID ASSEMBLY (OUTSIDE)
	X	D3267-043	BASKET LID ASSEMBLY (INSIDE)
2		D2327-3	SPACER BUSHING
1		D2506	LABEL PLATE
1		D2512-7	STRUT
2		D2581	MOUNTING BRACKET
	1	D2989-1	STRUT
	1	D2989-2	STRUT
	1	D2989-3	STRUT
	1	D2989-4	STRUT
	2	D2989-5	STRUT
	2	D2989-7	STRUT
1		D2989-9	STRUT
1		D2989-10	STRUT
1		D2989-11	STRUT
1		D2989-12	STRUT
2		D2989-13	STRUT
2		D2989-15	STRUT
	2	D3182-1	HINGE
2	2	D3265-3	STRUT
1		D3266-7	STRUT
2		D3267-1	STRUT
	2	D3442-3	SHIM

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 76647 M.C.J
11/1/18

RELEASED
08.09.14



NOTES:

- 1) FRAME MATERIAL: AISI 304/316 SS, 3/4 x 3/4 x 0.065 WALL SQUARE TUBING
REF. DART SPEC M304TS0.750W.065
(D2989-3/4/5/11/12/13 CAN BE MADE FROM D2236)
- 2) MESH MATERIAL: 3/4-16F EXPANDED SS
REF DART SPEC M304EX0.75-16F
- 3) FINISH: POWDER COAT ENTIRE ASSEMBLY WHITE (REF. 4.3.5.2) PER DART QSI 005 4.3.
BLACK ANTI-SKID PAINT INDICATED AREA PER DART QSI 005 4.4.
SPRAY PAINT INSIDE SURFACE BLACK PRIOR TO APPLYING ANTI-SKID.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: N/A
- 8) WELD PER DART QSI 004

C	DRAWING UPDATED TO CURRENT STANDARDS. SHEET 3 ADDED. FRAME MATERIAL WALL THICKNESS WAS 0.060. D3267-1 DETAILED.	AJS	08.08.15
B	ADD SHIM UNDER HINGES	PH	05.06.08
A	NEW ISSUE	DS	04.02.02
REV.	DESCRIPTION	BY	DATE
DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. C
MFG. APPR.	<i>[Signature]</i>	D3267	SHEET 1 OF 3
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	BASKET LID ASSEMBLY	NTS
DATE	08.08.15	COPYRIGHT © 2004 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector







Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

76647

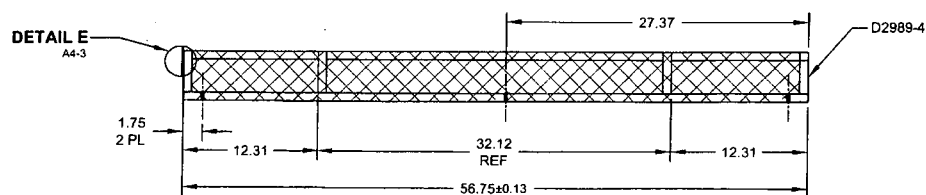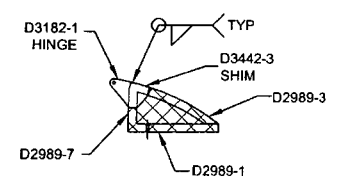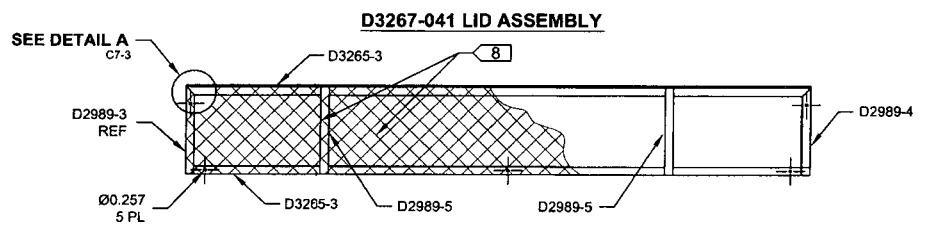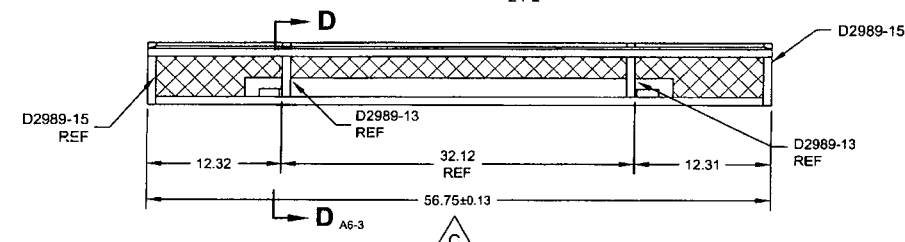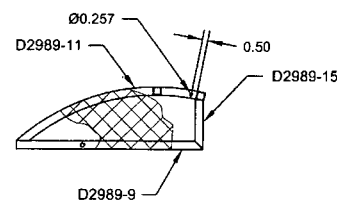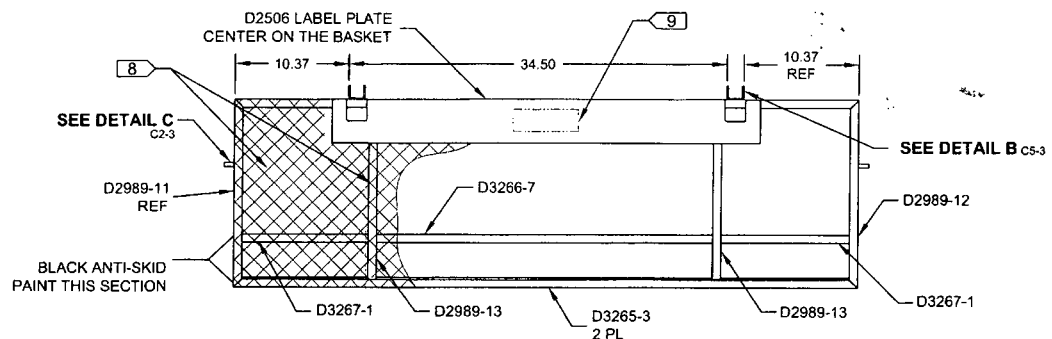

- NOTES:**
- 1) MATERIAL: SEE SHEET 1
 - 2) FINISH: SEE SHEET 1
 - 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
 - 4) UNITS: INCHES UNLESS OTHERWISE NOTED
 - 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
 - 6) IDENTIFICATION: N/A
 - 7) WEIGHT: N/A
 - 8) SKIN WITH EXPANDED STEEL MESH. TACK WELD MESH TO FRAME AT EVERY AVAILABLE LOCATION.
 - 9) REMOVE 2" x 6" SECTION OF MESH FROM BEHIND LABEL PLATE

D3267-041 LID ASSEMBLY

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. C
MFG. APPR.		D3267	2 OF 3
APPROVED		TITLE	SCALE
DE APPR.		BASKET LID ASSEMBLY	NTS
DATE	08.08.15	<small>COPYRIGHT © 2004 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


76647

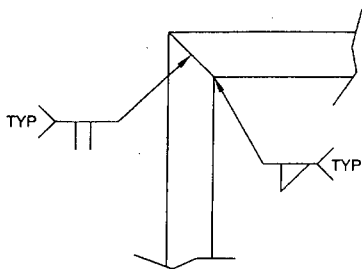


DETAIL A B5-2
JOINT WELD DETAIL TYP
SCALE 2X

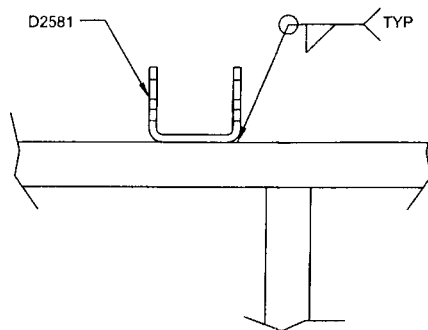


DETAIL B D2-2
2 PL
SCALE 2X

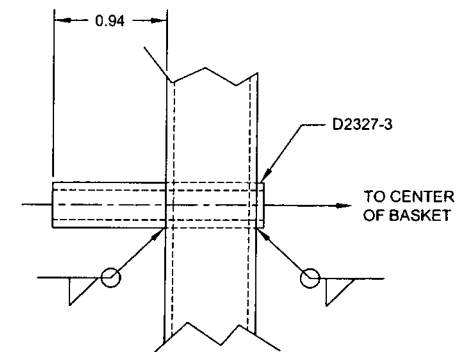


DETAIL C D5-2
SPACER INSTALLATION
SCALE 4X

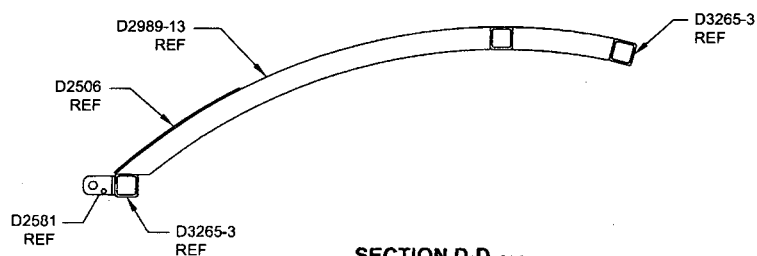

SECTION D-D C4-2

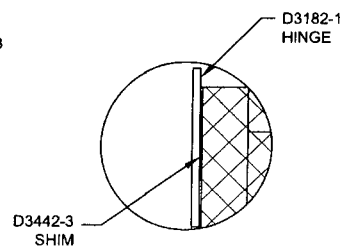

DETAIL E B6-2
SCALE 2X
2 PL



D3267-1 STRUT
SCALE 2X

RELEASED
08-07-15

DESIGN	QS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AUS		
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. C
MFG. APPR.	<i>[Signature]</i>	D3267	3 OF 3
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	BASKET LID ASSMEBLY	NTS
DATE	08.08.15	<small>COPYRIGHT © 2004 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART SERVICE INSTRUCTION

TO AMEND DRAWING D350-607 REV. F OR SUBSEQUENT APPROVED REVISION

REF CANADIAN STC: SH94-14

FAA STC: SR00213NY

EASA STC: EASA.IM.R.S.01405

THE PURPOSE OF THIS DART SERVICE INSTRUCTION (DSI), IS TO PROVIDE OPERATORS OF AS350 / 355 ROTORCRAFT EQUIPPED WITH DART D350-607-041 HELI UTILITY BASKETS WITH AN UPGRADE KIT TO REPLACE THE EXISTING LID PROP ARM WITH 2 GAS SPRINGS.

FOR OPERATORS EQUIPPED WITH D350-607-043/-045/-047 HELI UTILITY BASKETS THIS DSI WILL PROVIDE AN UPGRADE KIT TO REPLACE THE EXISTING LID PROP ARM WITH 1 GAS SPRING.

ITEM No.	QTY -141	QTY -143	QTY -145	PART NUMBER	DESCRIPTION
1	X			D350-607-141	AUTOMATIC LID OPENER INSTL (FOR USE ON -041 BASKET*)
2		X		D350-607-143	AUTOMATIC LID OPENER INSTL (FOR USE ON -043/-047 BASKET*)
3			X	D350-607-145	AUTOMATIC LID OPENER INSTL (FOR USE ON -045 BASKET*)
4	2		1	D3953-1	GAS SPRING BRACKET
5	2	1	1	D3953-3	GAS SPRING STUD (LID)
6	2	1	1	D3953-5	GAS SPRING STUD (BASE)
7	2	1	1	D3953-7	GAS SPRING SPACER
8	4	2	2	D3953-9	GAS SPRING WASHER
9	2	1	1	D3953-11	GAS SPRING SPACER
10	2		1	D3953-13	GAS SPRING SPACER
11		1		D3953-15	GAS SPRING BRACKET
12		1		D3953-17	GAS SPRING SPACER
13	2	1	1	D3969-1	GAS SPRING
14	4	2	2	AN3C11A	BOLT
15		2		AN3C15A	BOLT
18	4		2	AN3C16A	BOLT
19	4	2	2	AN310-4	CASTELLATED NUT
20	8	4	4	MS21043-3	NUT
21	4	2	2	MS24665-212	COTTER PIN
22	8	4	4	NAS1149C0332R	WASHER (OR AN960C10L)
23	4	2	2	NAS1149C0432R	WASHER (OR AN960C416L)

***NOTE:** FOR CUSTOMERS WISHING TO ORDER NEW BASKETS WITH THE LID OPENER PRE-INSTALLED USE THE FOLLOWING NUMBERS:

D350-607-041 BASKET WITH AUTOMATIC LID OPENER INSTALLED = D350-607-041A

D350-607-043 BASKET WITH AUTOMATIC LID OPENER INSTALLED= D350-607-043A

D350-607-045 BASKET WITH AUTOMATIC LID OPENER INSTALLED = D350-607-045A

D350-607-047 BASKET WITH AUTOMATIC LID OPENER INSTALLED = D350-607-047A

CANADA DEPARTMENT OF TRANSPORT AIRCRAFT CERTIFICATION BRANCH DAO # 01-O-01
APPROVED BY: <u>D. SHEPHERD (DE # 02)</u>
DATE: <u>09.11.11</u> CERT. NO.: <u>SH94-14</u> ISSUE NO.: <u>4</u>

C	SHEET 1 PL, -143 INSTL, ITEM 6 QTY WAS 2, ITEM 7 WAS 0.	AJS	09.11.11
B	SHT 1 P/L ITEM 22 WAS NAS1149C0332 ITEM 23 WAS NAS1149C0432H. ALL OTHER SHEETS UPDATED ACCORDINGLY. (REASON: DRAFTING ERROR) INSTALLATIONS RENAMED.	AJS	09.11.06
A	NEW ISSUE	AJS	09.09.15
REV.	DESCRIPTION	BY	DATE
DESIGN	AJS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED		DRAWING NO.	REV. C
MFG. APPR.	N/A	DSI 9473	SHEET 1 OF 8
APPROVED		TITLE	SCALE
DE APPR.		AUTOMATIC LID OPENER INSTL	NTS
DATE	09.11.11	COPYRIGHT © 2009 BY DART AEROSPACE LTD <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

FOR D350-607-041 BASKETS, REPLACE THE EXISTING D2332-041 PROP ARM ASSEMBLY AS FOLLOWS:

D350-607-141 AUTOMATIC LID OPENER INSTALLATION

NOTE: ONCE THIS MODIFICATION IS COMPLETE YOU WILL NOT BE ABLE TO RE-INSTALL THE D2332-041 PROP ARM.

- 1) REMOVE THE D2332-041 PROP ARM.
- 2) GRIND FLUSH THE D2327-3 SPACER BUSHING ON BOTH ENDS OF THE BASKET AS SHOWN IN FIGURE 1 (IT IS PERMISSIBLE TO GRIND ALL 4 SPACERS FLUSH). TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4.
- 3) LOCATE THE D3953-1 GAS SPRING BRACKET AS SHOWN IN FIGURE 1. TRIM STEEL MESH LOCALLY AS REQUIRED. TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4. TRANSFER MARK AND DRILL 2X Ø0.194 HOLES THRU THE BASKET LID SQUARE TUBE STRUCTURE AS SHOWN IN DETAIL A. INSTALL THE D3953-1 GAS SPRING BRACKET & D3953-13 GAS SPRING SPACER USING 2X AN3C16A BOLT, 2X NAS1149C0332R WASHER & 2X MS21043-3 NUT AS SHOWN IN VIEW E-E.
- 4) LOCATE THE D3953-5 GAS SPRING STUD AS SHOWN IN FIGURE 1. TRIM STEEL MESH LOCALLY AS REQUIRED. TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4. TRANSFER MARK AND DRILL 2X Ø0.194 HOLES THRU THE BASKET BASE SQUARE TUBE STRUCTURE AS SHOWN IN DETAIL B. FASTEN D3953-5 IAW VIEW F-F USING 2X AN3C11A BOLT, 2X NAS1149C0332R WASHER & 2X MS21043-3 NUT.
- 5) INSTALL 1X D3953-11 GAS SPRING SPACER ONTO THE D3953-5 STUD AS SHOWN IN VIEW F-F. INSTALL THE LARGE END OF THE D3969-1 GAS SPRING SPRING ONTO THE D3953-5 GAS SPRING STUD AND FASTEN IN PLACE USING 1X D3953-9 GAS SPRING WASHER, 1X NAS1149C0432R WASHER, 1X AN310-4 CASTELATTED NUT & 1X MS24665-212 COTTER PIN AS SHOWN IN VIEW F-F. INSTALL COTTER PIN PER MS33540 OR AC43.13 CHAPTER 7-127.
- 6) INSERT THE D3953-3 GAS SPRING STUD INTO THE D3953-1 GAS SPRING BRACKET & INSERT THE D3953-7 GAS SPRING SPACER ONTO THE D3953-3 GAS SPRING AS SHOWN IN VIEW E-E. RAISE THE BASKET LID AND INSTALL THE ROD END OF THE D3969-1 GAS SPRING ONTO THE D3953-3 GAS SPRING STUD USING 1X D3953-9 GAS SPRING WASHER, 1X NAS1149C0432R WASHER, 1X AN310-4 CASTELATTED NUT & 1X MS24665-212 COTTER PIN AS SHOWN IN VIEW E-E. INSTALL COTTER PIN PER MS33540 OR AC43.13 CHAPTER 7-127.

NOTE: THE D3953-3 GAS SPRING STUD CAN BE HELD IN PLACE WITH A $\frac{9}{16}$ OPEN END SPANNER / WRENCH.

NOTE: WITH THE LID IN THE CLOSED POSITION THE GAS SPRING SHOULD NOT BE FULLY COMPRESSED.




- 7) REPEAT STEPS 2 THROUGH 6 AT THE OTHER END OF THE BASKET.
- 8) TEST THE INSTALLATION. IF INSTALLED PROPERLY THE GAS SPRINGS SHOULD ASSIST THE BASKET USER IN BOTH OPENING AND CLOSING THE BASKET LID.

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED

BY: 
D. SHEPHERD (DE # 02)

DATE: 09.11.11
CERT. NO.: SH94-14
ISSUE NO.: 4

DESIGN	AJS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED		DRAWING NO.	REV. C
MFG. APPR.	N/A	DSI 9473	SHEET 2 OF 8
APPROVED		TITLE	SCALE
DE APPR.		AUTOMATIC LID OPENER INSTL	NTS
DATE	09.11.11	COPYRIGHT © 2009 BY DART AEROSPACE LTD <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

FOR D350-607-043/-047 BASKETS REPLACE THE EXISTING D2332-041 PROP ARM ASSEMBLY AS FOLLOWS:

D350-607-143 AUTOMATIC LID OPENER INSTALLATION

NOTE: THIS KIT MAY BE INSTALLED AT EITHER END OF THE BASKET. HOWEVER, THE PROP ARM MUST BE REMOVED IN EITHER CASE AS IT WILL INTERFERE WITH THE FUNCTION OF THE GAS SPRING.

- 1) REMOVE THE D2332-041 PROP ARM.
- 2) GRIND FLUSH THE D2327-3 SPACER BUSHING ON THE END OF THE BASKET WHERE THE LID OPENER IS BE INSTALLED AS SHOWN IN FIGURE 2 (IT IS PERMISSIBLE TO GRIND ALL 4 SPACERS FLUSH). TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4.
- 3) LOCATE THE D3953-15 GAS SPRING BRACKET AS SHOWN IN FIGURE 2. TRIM STEEL MESH LOCALLY AS REQUIRED. TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4. TRANSFER MARK AND DRILL 2X Ø0.194 HOLES THRU THE BASKET LID SQUARE TUBE STRUCTURE AS SHOWN IN DETAIL C. INSTALL THE D3953-15 GAS SPRING BRACKET & D3953-17 GAS SPRING SPACER USING 2X AN3C15A BOLT, 2X NAS1149C0332R WASHER & 2X MS21043-3 NUT AS SHOWN IN VIEW G-G.
- 4) LOCATE THE D3953-5 GAS SPRING STUD AS SHOWN IN FIGURE 2. TRIM STEEL MESH LOCALLY AS REQUIRED. TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4. TRANSFER MARK AND DRILL 2X Ø0.194 HOLES THRU THE BASKET BASE SQUARE TUBE STRUCTURE AS SHOWN IN DETAIL D. INSTALL 2X AN3C11A BOLT, 2X NAS1149C0332R WASHER & 2X MS21043-3 NUT AS SHOWN IN VIEW H-H. INSTALL THE ROD END OF THE D3969-1 GAS SPRING ONTO THE D3953-3 GAS SPRING STUD USING 1X D3953-9 GAS SPRING WASHER, 1X NAS1149C0432R WASHER, 1X AN310-4 CASTELATTED NUT & 1X MS24665-212 COTTER PIN AS SHOWN IN VIEW H-H. INSTALL COTTER PIN PER MS33540 OR AC43.13 CHAPTER 7-127.
- 5) INSERT THE D3953-3 GAS SPRING STUD INTO THE D3953-15 GAS SPRING BRACKET & INSERT THE D3953-7 GAS SPRING SPACER ONTO THE D3953-3 GAS SPRING STUD AS SHOWN IN VIEW G-G. RAISE THE BASKET LID AND INSTALL THE D3969-1 GAS SPRING ONTO THE D3953-3 GAS SPRING STUD AND FASTEN IN PLACE USING 1X D3953-9 GAS SPRING WASHER, 1X NAS1149C0432R WASHER, 1X AN310-4 CASTELATTED NUT & 1X MS24665-212 COTTER PIN AS SHOWN IN VIEW G-G. INSTALL COTTER PIN PER MS33540 OR AC43.13 CHAPTER 7-127.

NOTE: THE D3953-3 GAS SPRING STUD CAN BE HELD IN PLACE WITH A $\frac{9}{16}$ OPEN END SPANNER / WRENCH.

NOTE: WITH THE LID IN THE CLOSED POSITION THE GAS SPRING SHOULD NOT BE FULLY COMPRESSED.




- 6) TEST THE INSTALLATION. IF INSTALLED PROPERLY THE GAS SPRING SHOULD ASSIST THE BASKET USER IN BOTH OPENING AND CLOSING THE BASKET LID.

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED

BY: 
D. SHEPHERD (DE # 02)

DATE: 09.11.11
CERT. NO.: SH94-14
ISSUE NO.: 4

DESIGN	AJS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED		DRAWING NO.	REV. C
MFG. APPR.	N/A	DSI 9473	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		AUTOMATIC LID OPENER INSTL	NTS
DATE	09.11.11	COPYRIGHT © 2009 BY DART AEROSPACE LTD <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

FOR D350-607-045 BASKETS REPLACE THE EXISTING D2332-041 PROP ARM ASSEMBLY AS FOLLOWS:

D350-607-145 AUTOMATIC LID OPENER INSTALLATION

NOTE: THIS KIT MAY BE INSTALLED AT EITHER END OF THE BASKET. HOWEVER, THE PROP ARM MUST BE REMOVED IN EITHER CASE AS IT WILL INTERFERE WITH THE FUNCTION OF THE GAS SPRING.

- 1) REMOVE THE D2332-041 PROP ARM.
- 2) GRIND FLUSH THE D2327-3 SPACER BUSHING ON THE END OF THE BASKET WHERE THE LID OPENER IS BE INSTALLED AS SHOWN IN FIGURE 1 (IT IS PERMISSIBLE TO GRIND ALL 4 SPACERS FLUSH). TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4.
- 3) LOCATE THE D3953-1 GAS SPRING BRACKET AS SHOWN IN FIGURE 1. TRIM STEEL MESH LOCALLY AS REQUIRED. TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4. TRANSFER MARK AND DRILL 2X Ø0.194 HOLES THRU THE BASKET LID SQUARE TUBE STRUCTURE AS SHOWN IN DETAIL A. INSTALL THE D3953-1 GAS SPRING BRACKET & D3953-13 GAS SPRING SPACER USING 2X AN3C16A BOLT, 2X NAS1149C0332R WASHER & 2X MS21043-3 NUT AS SHOWN IN VIEW E-E.
- 4) LOCATE THE D3953-5 GAS SPRING STUD AS SHOWN IN FIGURE 1. TRIM STEEL MESH LOCALLY AS REQUIRED. TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4. TRANSFER MARK AND DRILL 2X Ø0.194 HOLES THRU THE BASKET BASE SQUARE TUBE STRUCTURE AS SHOWN IN DETAIL B. FASTEN D3953-5 IAW VIEW F-F USING 2X AN3C11A BOLT, 2X NAS1149C0332R WASHER & 2X MS21043-3 NUT.
- 5) INSTALL 1X D3953-11 GAS SPRING SPACER ONTO THE D3953-5 STUD AS SHOWN IN VIEW F-F. INSTALL THE LARGE END OF THE D3969-1 GAS SPRING SPRING ONTO THE D3953-5 GAS SPRING STUD AND FASTEN IN PLACE USING 1X D3953-9 GAS SPRING WASHER, 1X NAS1149C0432R WASHER, 1X AN310-4 CASTELATTED NUT & 1X MS24665-212 COTTER PIN AS SHOWN IN VIEW F-F. INSTALL COTTER PIN PER MS33540 OR AC43.13 CHAPTER 7-127.
- 6) INSERT THE D3953-3 GAS SPRING STUD INTO THE D3953-1 GAS SPRING BRACKET & INSERT THE D3953-7 GAS SPRING SPACER ONTO THE D3953-3 GAS SPRING AS SHOWN IN VIEW E-E. RAISE THE BASKET LID AND INSTALL THE ROD END OF THE D3969-1 GAS SPRING ONTO THE D3953-3 GAS SPRING STUD USING 1X D3953-9 GAS SPRING WASHER, 1X NAS1149C0432R WASHER, 1X AN310-4 CASTELATTED NUT & 1X MS24665-212 COTTER PIN AS SHOWN IN VIEW E-E. INSTALL COTTER PIN PER MS33540 OR AC43.13 CHAPTER 7-127.

NOTE: THE D3953-3 GAS SPRING STUD CAN BE HELD IN PLACE WITH A $\frac{9}{16}$ OPEN END SPANNER / WRENCH.

NOTE: WITH THE LID IN THE CLOSED POSITION THE GAS SPRING SHOULD NOT BE FULLY COMPRESSED.




- 7) TEST THE INSTALLATION. IF INSTALLED PROPERLY THE GAS SPRING SHOULD ASSIST THE BASKET USER IN BOTH OPENING AND CLOSING THE BASKET LID.


CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED

BY: 
D. SHEPHERD (DE # 02)

DATE: 09.11.11
CERT. NO.: SH94-14
ISSUE NO.: 4

DESIGN	AJS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. C
MFG. APPR.	N/A	DSI 9473	SHEET 4 OF 8
APPROVED		TITLE	SCALE
DE APPR.		AUTOMATIC LID OPENER INSTL	NTS
DATE	09.11.11	COPYRIGHT © 2009 BY DART AEROSPACE LTD <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

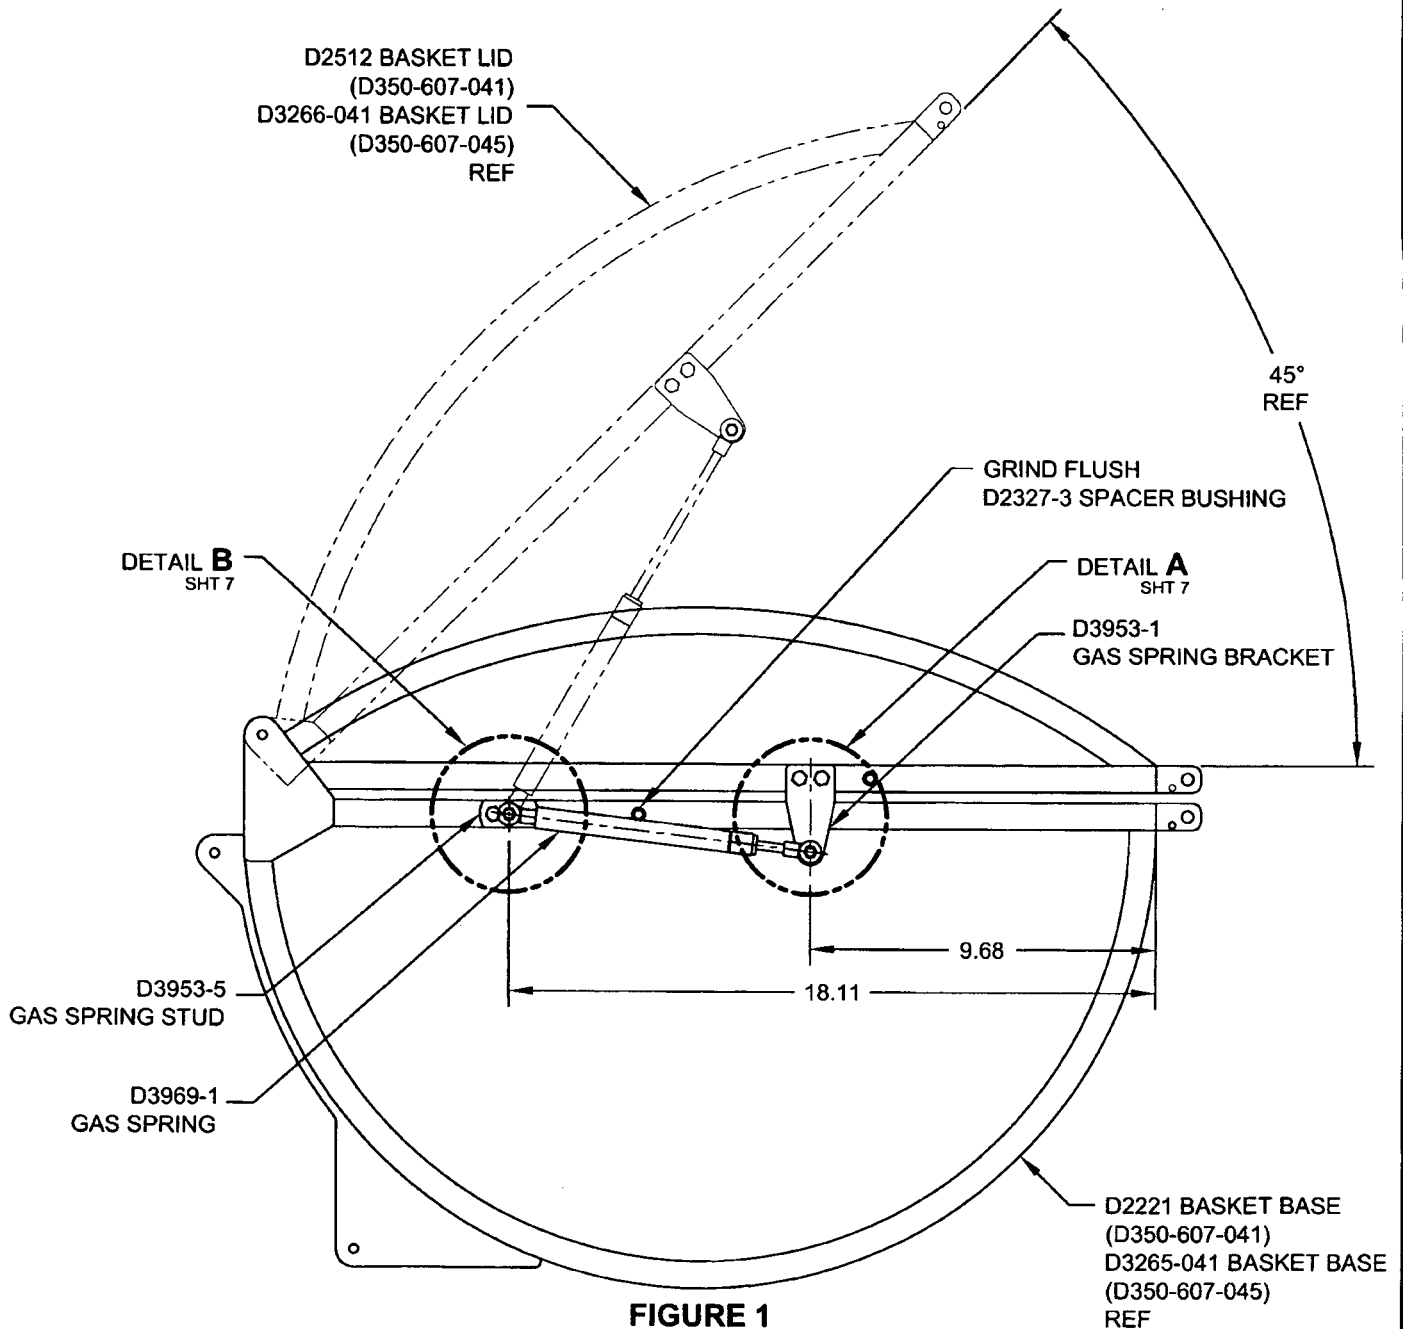

D350-607-141 AUTOMATIC LID OPENER INSTALLATION
(BOTH ENDS)




D350-607-145 AUTOMATIC LID OPENER INSTALLATION
(1 END ONLY)

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED

BY: *[Signature]*
D. SHEPHERD (DE # 02)

DATE: 09.11.11
CERT. NO.: SH94-14
ISSUE NO.: 4

DESIGN	AJS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED		DRAWING NO.	REV. C
MFG. APPR.	N/A	DSI 9473	SHEET 5 OF 8
APPROVED		TITLE	SCALE
DE APPR.		AUTOMATIC LID OPENER INSTL	NTS
DATE	09.11.11	COPYRIGHT © 2009 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

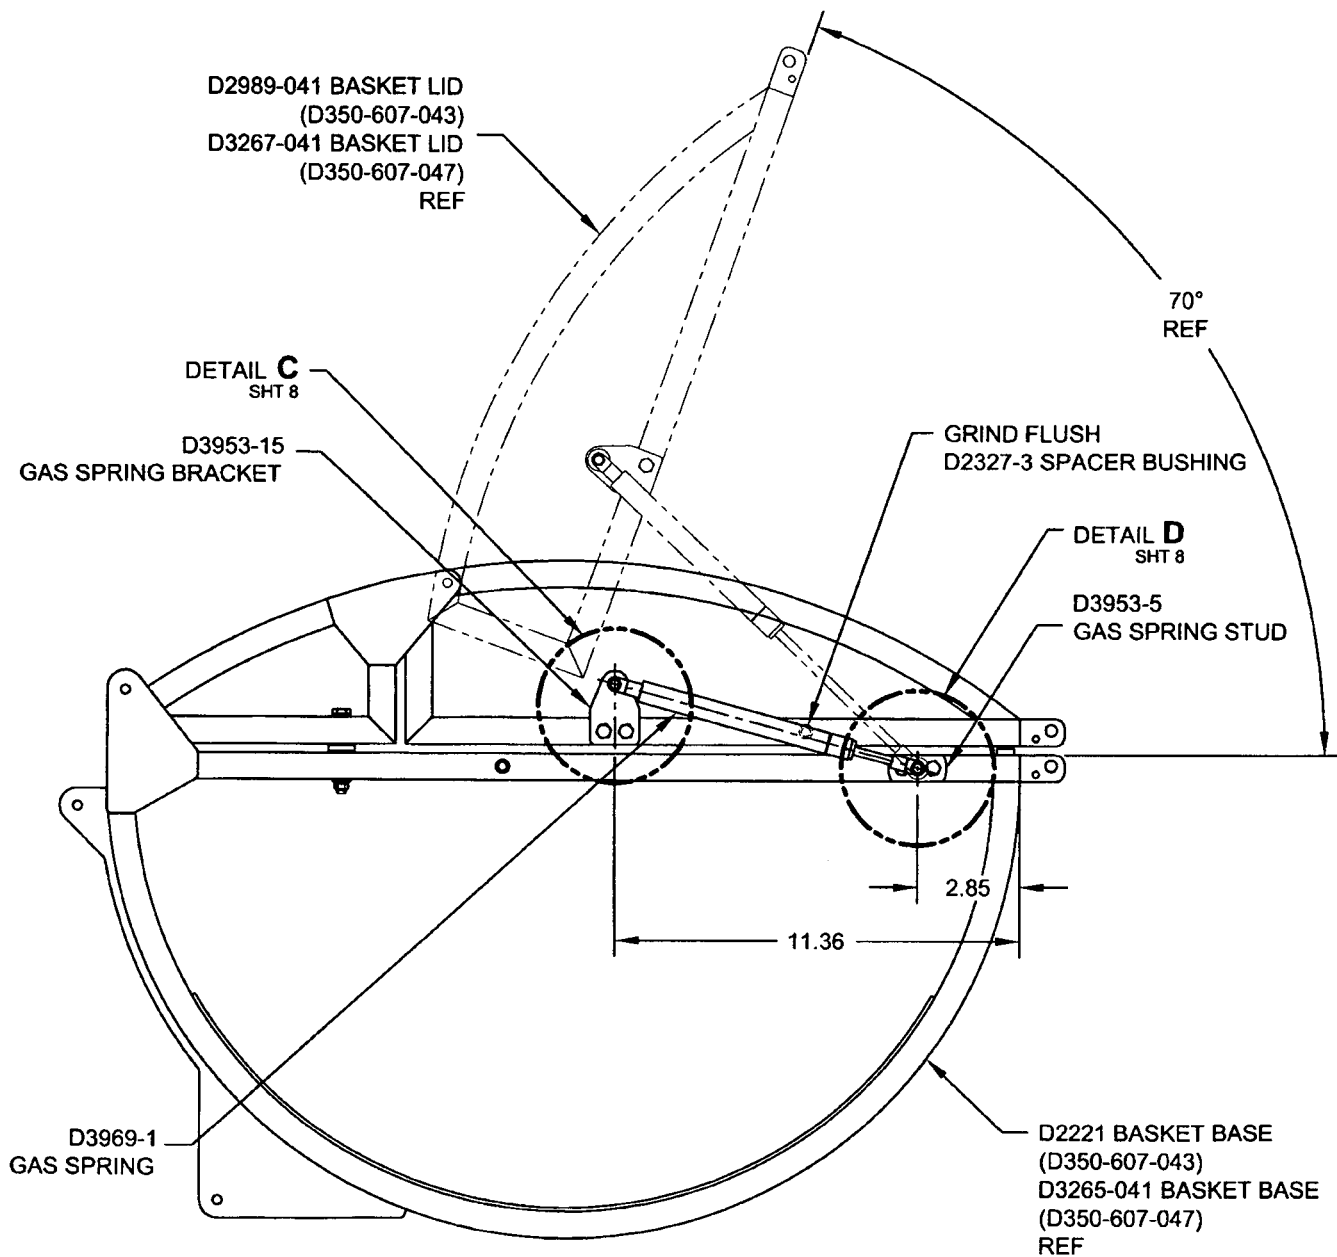





FIGURE 2
D350-607-143 AUTOMATIC LID OPENER INSTALLATION
 (1 END ONLY)

CANADA
 DEPARTMENT OF TRANSPORT
 AIRCRAFT CERTIFICATION
 BRANCH
 DAO # 01-O-01

APPROVED

BY: *[Signature]*
 D. SHEPHERD (DE # 02)

DATE: 09.11.11
 CERT. NO.: SH94-14
 ISSUE NO.: 4

DESIGN	AJS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED		DRAWING NO.	REV. C
MFG. APPR.	N/A	DSI 9473	SHEET 6 OF 8
APPROVED		TITLE	SCALE
DE APPR.		AUTOMATIC LID OPENER INSTL	NTS
DATE	09.11.11	COPYRIGHT © 2009 BY DART AEROSPACE LTD	
		THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


AN3C11A BOLT
NAS1149C0332R WASHER
MS21043-3 NUT
2 PL

D3953-5
GAS SPRING STUD
REF

D3953-11
GAS SPRING SPACER

D3953-9
GAS SPRING WASHER

AN310-4 CASTELLATED NUT
MS24665-212 COTTER PIN
NAS1149C0432R WASHER

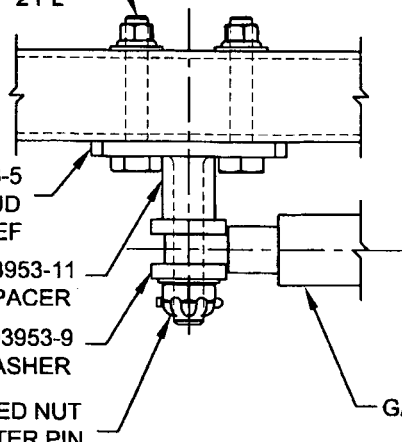

VIEW F-F

AN3C16A BOLT
NAS1149C0332R WASHER
MS21043-3 NUT
2 PL

D3953-13
GAS SPRING SPACER


D3953-1
GAS SPRING BRACKET
REF

D3953-7
GAS SPRING SPACER

D3953-9
GAS SPRING WASHER


D3953-3 GAS SPRING STUD
AN310-4 CASTELLATED NUT
MS24665-212 COTTER PIN
NAS1149C0432R WASHER

D3969-1
GAS SPRING
REF

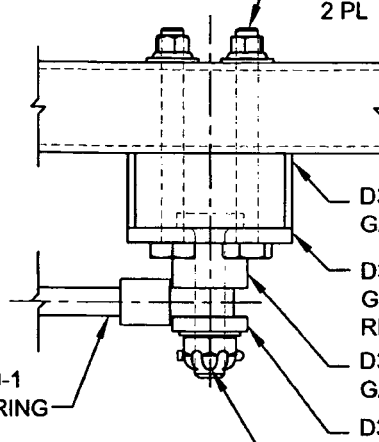

VIEW E-E


D3953-5
GAS SPRING STUD
REF

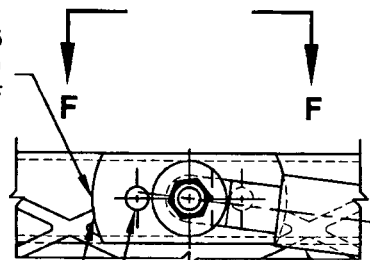

TRIM MESH LOCALLY
AS REQUIRED

TRANSFER MARK AND
DRILL Ø0.194 THRU
2 PL

DETAIL B

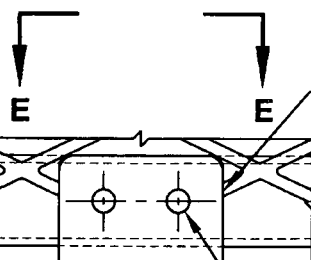

TRIM MESH LOCALLY
AS REQUIRED

TRANSFER MARK AND
DRILL Ø0.194 THRU

D3969-1
GAS SPRING
REF

D3953-1
GAS SPRING BRACKET
REF




DETAIL A





CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED

BY: *[Signature]*
D. SHEPHERD (DE # 02)

DATE: 09.11.11
CERT. NO.: SH94-14
ISSUE NO.: 4

DESIGN	AJS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED		DRAWING NO.	REV. C
MFG. APPR.	N/A	DSI 9473	SHEET 7 OF 8
APPROVED		TITLE	SCALE
DE APPR.		AUTOMATIC LID OPENER INSTL	NTS
DATE	09.11.11	COPYRIGHT © 2009 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

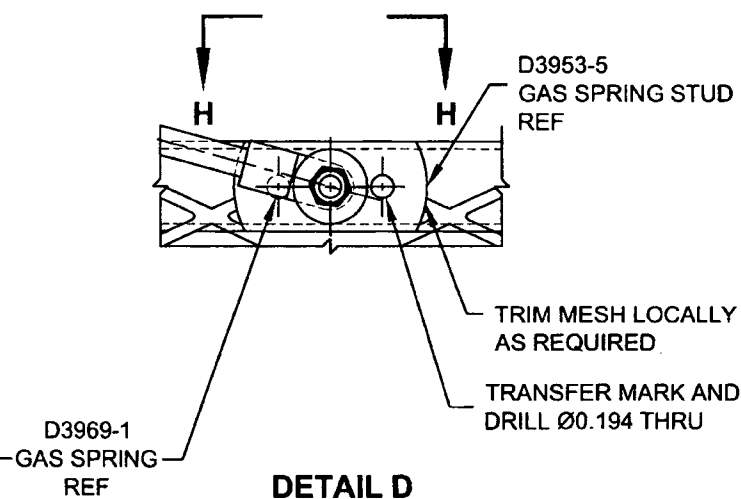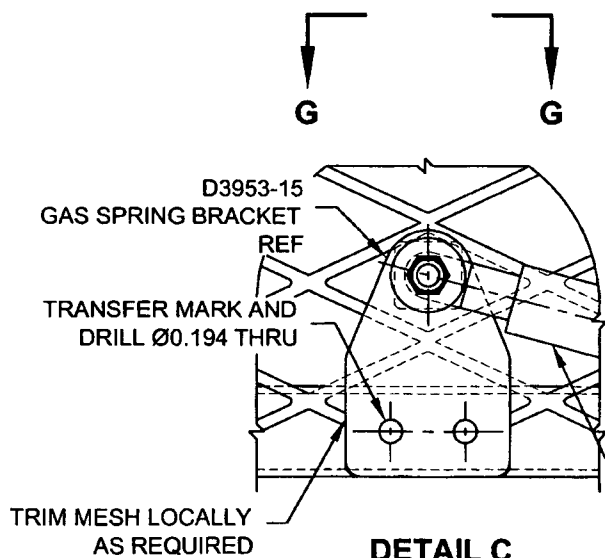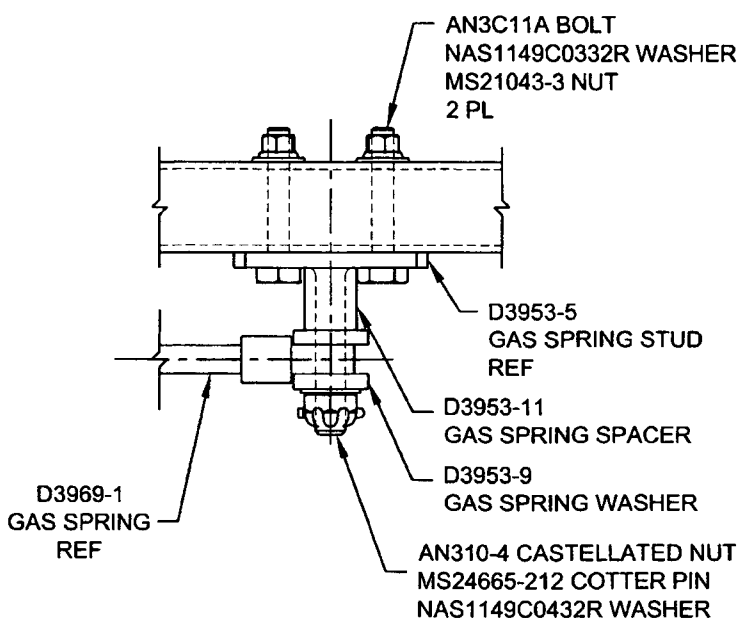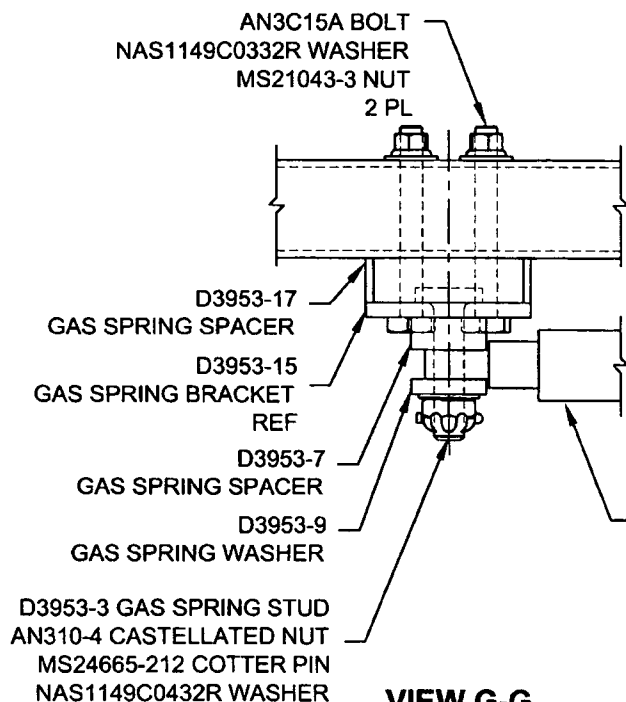

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED

BY: *[Signature]*
D. SHEPHERD (DE # 02)

DATE: 09.11.11
CERT. NO.: SH94-14
ISSUE NO.: 4

DESIGN	AJS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. C
MFG. APPR.	N/A	DSI 9473	SHEET 8 OF 8
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	AUTOMATIC LID OPENER INSTL	NTS
DATE	09.11.11	COPYRIGHT © 2009 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	